


HDSL4 T200 H4TU-R

CLEI: T1L32VTA_ _

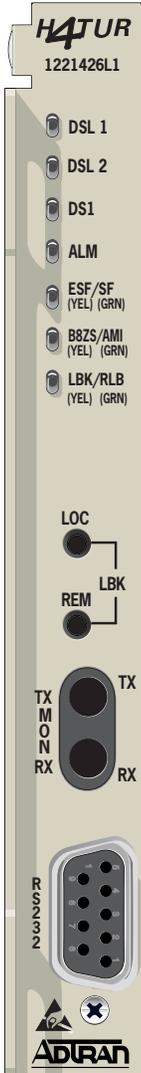

LED STATUS

- DSL1/DSL2**
- Off HDSL synchronization has not been achieved on Loop1/Loop 2 between the H4TU-C and the H4TU-R.
 - Green Normal operation; signal quality (SNR Margin) is optimum on Loop1/Loop 2 between the H4TU-C and the H4TU-R.
 - Yellow Marginal operation; signal quality (SNR Margin) is marginal on Loop1/Loop 2 between the H4TU-C and the H4TU-R.
 - Red Severely impaired operation; signal quality (SNR Margin) is 0 dB on Loop1/Loop 2 between the H4TU-C and the H4TU-R.
 - * Blinking If the pulse attenuation is below the user defined Loop Attenuation Alarm Threshold, the DSL LED will remain solid. If the pulse attenuation is above the threshold for quality service the DSL LED will blink Green, Yellow or Red as determined by the signal quality.
NOTE: If the signal quality is good and the pulse attenuation is bad, the LED will blink Green. If the signal quality is marginal and the pulse attenuation is good, the LED will be solid Yellow.
- DS1**
- Off DS1 signal from the CPE is present at the H4TU-R.
 - Red DS1 signal from the CPE is absent at the H4TU-R.
- ALM**
- Off No alarm condition detected
 - Red Alarm condition detected either locally (H4TU-R) or locally and remotely (H4TU-R and H4TU-C)
 - Yellow Remote (H4TU-C) alarm condition detected
- ESF/SF**
- Off Indicates DS1 is provisioned for unframed operation
 - Green Indicates DS1 is provisioned for SF framing mode
 - Yellow Indicates DS1 is provisioned for ESF framing mode
- B8ZS/AMI**
- Green The unit is provisioned for AMI line code.
 - Yellow The unit is provisioned for B8ZS line code.
- LBK/RLB**
- Off Unit is not in the armed or loopback state.
 - Yellow A local loopback is active on this specific unit.
 - Green A remote loopback is active on this specific unit.

NOTE: When used with an ADTRAN H4TU-C, the terminal screens via the H4TU-R will display information that is stored at the H4TU-C.

OPTIONS

Faceplate Buttons

- LOC** Initiates a bidirectional loopback of the H4TU-R toward the network and customer
- REM** Initiates a loopback at the H4TU-C toward the customer

POWER

This specific unit is intended for **Span Power Only**. If a Locally Powered unit is needed, refer to P/N 1221424L1.

DS1 MONITOR JACKS

- TX** DS1 signal from CPE toward Network (nonintrusive)
- RX** DS1 signal from Network toward CPE (nonintrusive)

COMPLIANCE CODES


Caution: Up to -200 VDC may be present on telecommunications wiring.

This product is intended for installation in restricted access locations only and in equipment with a Type "B" or "E" enclosure.

Ensure chassis ground is properly connected.

Code	Input	Output
Installation Code (IC)	A	-
Telecommunication Code (TC)	X	X
Power Code (PC)	C	C

CARD EDGE PIN ASSIGNMENTS

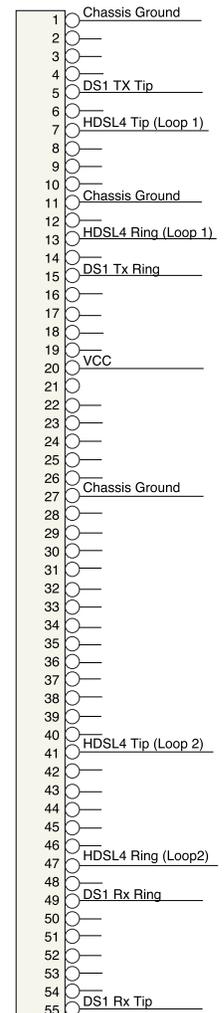

ADTRAN HDSL4 equipment is designed with troubleshooting-at-a-glance features. The following information provides suggestions for troubleshooting as a result of LED indications which are indicative of loop trouble.

Note: Pressing "ESC" while on any screen will go back to the previous screen.

INDICATIONS AND POSSIBLE CAUSES

DSL LED Yellow

Connect a terminal or PC to the RS-232 (DB-9) craft interface on faceplate. The terminal must be VT100 or compatible and set for 1.2 to 19.2 kbps, 8 data bits, no parity, 1 stop bit, No Flow control. Select "3" from the ADTRAN HDSL4 Main Menu Screen and "1" from the Span Status Screen. Verify the following conditions on the Detailed HDSL4 and T1 Status Screen:

- Margin \geq 6 dB
- Pulse Attenuation \leq 35 dB (1st segment)
- Pulse Attenuation \leq 31 dB (2nd segment)
- No ES, SES, or UAS (Performance History Screen, Main Menu Selection 5)

If the above conditions do exist, the circuit should provide quality service; however, if any of the above conditions do not exist, a cable problem or excessive loss situation is probable, and more detailed cable testing should be done to verify all HDSL4 Loop Specifications are met. These conditions may also reflect intermittent cable faults or excessive noise impairments. If intermittent faults or noise impairments are suspected, review the Performance History Screen.

Circuit ID:		01/07/00 18:18:32					
Press ESC to return to previous menu							
Detailed Status Screen							
Interface	MARGIN (CUR/MIN/MAX)	LOOP 1		ESTIMATED INS. LOSS	LOOP 2		
		ATTEN (CUR/MAX)			ATTEN (CUR/MAX)	ESTIMATED INS. LOSS	
H4TU-C	17/00/17	00/00	00	17/00/17	00/00	00	
H4R1 NETW	17/00/17	00/00	00	17/00/17	00/00	00	
H4R1 CUST	17/00/17	00/00	00	17/00/17	00/00	00	
H4R2 NETW	17/00/17	00/00	00	17/00/17	00/00	00	
H4R2 CUST	17/00/17	00/00	00	17/00/17	00/00	00	
H4TUR	17/00/17	00/00	00	17/00/17	00/00	00	

1. Reset Min/Max
 2. View Performance History

HDSL4 DEPLOYMENT GUIDELINES

The first segment of the circuit is defined as the section of the HDSL4 loop between the H4TU-C and the first H4R, the second segment is between the first H4R and the second H4R (dual repeater designs) or between the H4R and the H4TU-R (single repeater designs), and the third segment is between the second H4R and the H4TU-R.

NOTE: If dual repeaters are used in the circuit, please refer to the "HDSL4 Deployment Guidelines" section of the Installation and Maintenance Practice for DC resistance guidelines for span powering.

- Margin \geq 6 dB
- Pulse Attenuation \leq 35 dB (1st segment)
- Pulse Attenuation \leq 31 dB (2nd/3rd segment)
- All loops are nonloaded
- Any single bridge tap is limited to 2 kft
- Total bridge tap length is limited to 2.5 kft
- Loop length up to 16 kft (24 AWG) on circuit containing no H4Rs
- Loop length up to 16 kft first segment and 15 kft second segment (24 AWG) on circuit containing one H4R
- Loop length up to 13.5 kft first segment, 14 kft second segment, 15 kft third segment (24 AWG) on circuit containing two H4Rs
- First segment (or a circuit containing no H4Rs) Insertion Loss \leq 46 dB
- Second and third segment Insertion Loss \leq 42 dB
- Maximum loop resistance is 1150 Ohms for circuits without an H4R.
- Impulse Noise =50 dBm as measured using a 50 kb filter
- Wideband Noise =31 dBm as measured using a 50 kb filter
- Foreign Voltage DC (t-r, t-g, r-g) < 3 VDC
- Insulation Resistance (t-r, r-g, t-g) > 3.5 M
- Longitudinal Noise (Power Influence) < 80 dBmC

LOOPBACK AND CONTROL CODES

Pattern	Description	Requires Arming?
1in3	Loop down all units and disarm	No
2in5	Arming Pattern, HTU-R will loop up if Smartjack LB is enabled	No
3in5	Disarm and loop down all units. Restores LB TMO after D5D6	No
1in6	Network Arming Pattern. If Smartjack LB is Enabled, HTU-R will loop toward Network.	No
2in6	H4R LB to Network	
3in6	H4R LB to Network	
4in6	H4R LB to Customer	
5in6	H4R LB to Customer	
3in7	H4TU-R LB to Network	No
4in7	H4TU-C LB to Network	No
5in7	H4TU-R LB to Customer	No
6in7	H4TU-C LB to Customer	No
3F1E	H4TU-C LB to Customer	No
3F02	H4TU-R LB to Customer	No
3F04	H4R LB to Customer	
3F06	H4R LB to Customer	
6767	Disable span powering while present	Yes
9393	Loop down HTU-C, Repeaters - all loopbacks. Loop down H4TU-R - Cust LB always.	
	Will only loop down HTU-R Net LB if NIU is disabled. Does not Disarm units if they are armed.	No
C741	H4R #1 loop up pattern. 10 bit error injection.	Yes
C742	H4TU-R loop up pattern. 20 bit error injection.	Yes
C754	H4R #2 loop up pattern. 200 bit error injection.	Yes
D3D3	H4TU-C loop up pattern. 231 bit error injection.	Yes
D5D5	Query Loopback Pattern (error injection)	
	H4TU-C: 231 Errors, H4R #1: 10 Errors, H4R #2: 200 Errors, H4TU-R: 20 Errors	No
D5D6	Loopback Timeout Override: Disables LB timeout. Restores original LB timeout when unit is disarmed.	Yes
FF48	FDL Arming Pattern (ESF only). Arms all units, H4TU-R will LB to Network if NIU Enabled (if pattern sources at network).	No
FF24	FDL Disarm Pattern (ESF only). Loop down and disarm all units	No
FF1E	H4TU-C LB to Network. Will not loop up H4TU-C if H4TU-C already in LB to Customer.	No
FF02	H4TU-R LB to Network. Will not loop up H4TU-R if any unit already in LB to Customer.	No
FF04	H4R LB to Network	
FF06	H4R LB to Network	

WARRANTY

Warranty for Carrier Networks products manufactured by ADTRAN and supplied under Buyer's order for use in the U.S. is ten (10) years. For a complete faxback copy of ADTRAN's U.S. and Canada Carrier Networks Equipment Warranty (P/N 60000087-10), call: (877) 457-5007, document #414.